

### EG-650 EG-650s

适用注塑机吨位：40~100ton  
Injection Press Range: 40~100ton



### STEC-NC3

#### 新型多功能操作盒

New type pendant with multi-function

功能更多样、操作更简单便捷  
Variety function, more convenient and simpler operation

## 综合参数 | GENERAL SPECIFICATIONS

电源 Power Source	常用气压 Air Pressure	驱动方式 Drive System	姿势(气缸) Posture (Air Cylinder)	气动姿势部推力(气压:0.49Mpa时) Air Cylinder Driving Force (Air Pressure at 0.49Mpa)		控制箱 Control Box
				最大可搬重量 Max. Load	姿势力矩 Posture Torque	
AC200V ±10% 50/60Hz (三相) 3 Phase	0.49Mpa	AC伺服马达 AC Servo Motor	90°固定 90° Fixed	标准姿势部:3kg (含夹具重量) Incl Chuck Weight	4.9N·m	STEC-NC3

机种 Model	行程(移动量)(mm) Stroke				电源设备容量 (KVA) Electric Consumpton	最大消费电力 (KW) Max Power Consumpton	机器重量(kg) Net Weight		空气消耗量 (Nℓ/周期) Air Consumption (Nℓ/Cycle)
	制品上下 Ⓟ Vertical	水口上下 Ⓡ Vertical	前后 Crosswise	走行 Traverse			本体 Main Body	操作盒 Pendant	
EG-650	650 [800]	—	75~555 [75~675]	1200 [1000]	1.7	1.45	153	2.0	1.9
EG-650s		700 [850]	Ⓟ 225~555 Ⓡ 93~423 [Ⓟ 225~675] [Ⓡ 93~543]	[1400] [1600]	2.6	2.05	173		

Ⓟ [ ]尺寸表示选项行程。

Ⓡ 本体重量包括控制箱及电缆线的重量。

Ⓟ 表示制品侧手臂, Ⓡ 表示水口侧手臂。

Ⓡ 将走行行程为1200和1600mm行程的走行侧向取出侧移动200mm时,走行行程将变为1000和1400mm。

Ⓡ Figure in [ ] shows option stroke.

Ⓡ Net weight includes the weight of interlock box and driver box.

Ⓟ In the column of stroke, Ⓟ stands for product side arm and Ⓡ stands for runner side arm.

Ⓡ Make the travers as 1200 and 1600 mm moving forward to extracting side as 200 mm it will be 1000 and 1400 mm.


## 标准功能 | STANDARD FUNCTIONS

<b>取出侧</b> Product Extract Side	<input checked="" type="checkbox"/> 取出下降待机 Delayed arm descent	<input checked="" type="checkbox"/> 前进取出侧姿势控制 Crosswise product extract side posture control	<input checked="" type="checkbox"/> 吸着确认单元 (1回路) Vacuum confirmation unit (1circuit)	<input checked="" type="checkbox"/> 自由滑移取出 Free extract for under-cut mold
<b>走行</b> Traverse	<input checked="" type="checkbox"/> 顶针联动 Ejector link	<input checked="" type="checkbox"/> 顶针后退联动 Ejector return link	<input checked="" type="checkbox"/> 水口模内开放 Runner release within mold	<input checked="" type="checkbox"/> 固定可动切换 Extraction from fixed mold
<b>落下侧</b> Product Release Side	<input checked="" type="checkbox"/> 落下侧下降途中姿势 Posture midway descent at release side	<input checked="" type="checkbox"/> 浇口途中开放 (走行/复归) Midway runner release (Move·Revert)	<input checked="" type="checkbox"/> 不良品排出 Defective product reject	<input checked="" type="checkbox"/> 初期不良品排出 Initial defective product reject
<b>其它</b> Other	<input checked="" type="checkbox"/> 装箱点 Point packaging	<input checked="" type="checkbox"/> 自由装箱点 (8级, 共1024点) Point free packaging (8 stage, 1024 points)	<input checked="" type="checkbox"/> 输送带启动信号 Start signal of conveyor	<input checked="" type="checkbox"/> 前后自由伺服点 Crosswise Free Servo point
	<input checked="" type="checkbox"/> 3国语言切换 (简体中文、日文、英文) Three language exchange (Chinese(new), Japanese, English)	<input checked="" type="checkbox"/> 插入式用户编程 Easy NC steps (USER PROGRAM EDITING)	<input checked="" type="checkbox"/> 操作盒内置存储记忆 External storage memory	<input checked="" type="checkbox"/> 伺服休眠 Servo sleep feature
	<input checked="" type="checkbox"/> 设定值隐藏功能 Default blind feature	<input checked="" type="checkbox"/> 背景灯自动OFF Backlight Auto OFF	<input checked="" type="checkbox"/> 伺服监视 (波形监视) Servo monitor (Wave shape monitor)	



# 选项功能 | OPTION FUNCTIONS

<b>取出侧</b> Product Extract Side	<input type="checkbox"/> 吸着确认单元 (2回路) Vacuum confirmation unit (2circuits)	<input type="checkbox"/> 吸着确认单元 (4回路) Vacuum confirmation unit (4circuits)	<input type="checkbox"/> 夹具减压阀 Chuck pressure regulator
	<input type="checkbox"/> 旋转功能 Rotation Unit	<input type="checkbox"/> 上升途中闭模 Mold close during arm ascent	<input type="checkbox"/> 制品确认 (LS-4) Product confirmation LS-4
<b>落下侧</b> Product Release Side	<input type="checkbox"/> 剪切回路(夹具内) Air nipper in chuck circuit	<input type="checkbox"/> 制品2点开放 Release product at two different points	<input type="checkbox"/> 制品4点开放 Release product at four different points
			<input type="checkbox"/> NT剪切·可动侧(有单元) NT gate cutting on crossmember of moving mold side (w/unit)
<b>其它</b> Other	<input type="checkbox"/> 警报灯 (红色·无蜂鸣器) Alarm Lamp (Red color,w/o buzzer)	<input type="checkbox"/> 自动快速交换用夹具 (气压式) Quick chuck change automatic (air sw)	<input type="checkbox"/> 操作盒支架 Pendant stand
			<input type="checkbox"/> 欧规 12 (SPI) EUROMAP 12 (SPI)
			<input type="checkbox"/> 欧规 67 EUROMAP 67

# 外观尺寸 | OUTER DIMENSIONS

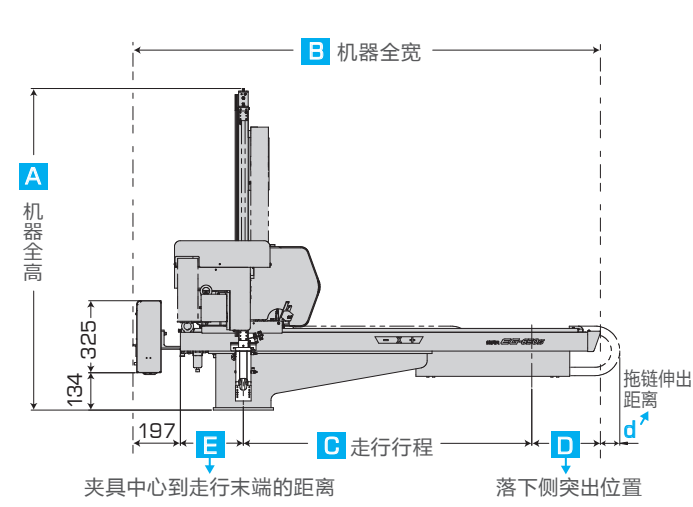

(单位: mm)

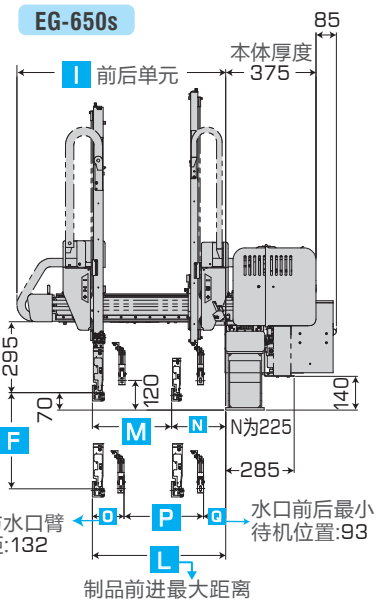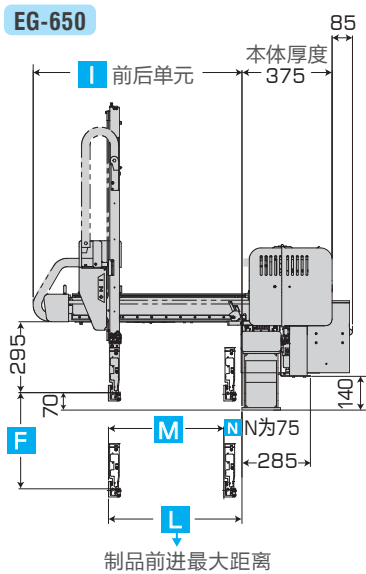

●因改良等原因,规格及外观有所变更时,不再另行通知,敬请谅解和包涵。

机种	规格	C	B	D	E	d
EG-650 EG-650s	标准规格	1200	1945	286	262	80
	选项: 走行1200规格, 走行体向取出侧移动200时	1000	1945	286	462	80
	选项: 走行1600规格, 走行体向取出侧移动200时	1400	2365	306	462	80
	选项: 走行行程从标准规格延长400时	1600	2365	306	262	80

※d值反操作时都为58。  
 ※反操作时D、E值与正操作时相同  
 ※水口夹的厚度为25mm。  
 ※姿势部厚度为45mm,但根据配管方式不同,此尺寸多少会有些不同。

**F** 制品侧上下行程 | **P** 水口侧前进行程MAX | **M** 制品前进行程MAX | **N** 制品前后待机最小距离

机种	规格	F	A	规格	M	L	I	P
EG-650	标准规格	650	1280	标准规格	480	555	870	
	选项: 制品上下行程延长150时	800	1417	选项: 制品前后行程延长120时	600	675	990	
EG-650s	标准规格	650	1340	标准规格	330	555	870	330
	选项: 制品上下行程延长150时	800	1460	选项: 制品前后行程延长120时	450	675	990	450

※水口侧上下行程比制品侧上下行程长50mm。

## 星精机械(上海)有限公司 STAR SEIKI (SHANGHAI) CO., LTD.



## STAR中国地区销售服务网络信息 <http://www.starseiki.cn>

### 华东地区

- 大陆地区总部: 星精机械(上海)有限公司**  
 地址: 上海市徐汇区桂平路555号46栋208室  
 ☎ +86-021-5423 4571  
 ●苏州事务所 ☎ +86-0512-6805 8385  
 ●厦门事务所 ☎ +86-0592-577 9994  
 ●余姚事务所 ☎ +86-0574-6253 2721  
 ●青岛分公司 ☎ +86-0532-5556 5517

### 华北/东北地区

- 天津分公司 ☎ +86-022-5838 7675  
 ●大连分公司 ☎ +86-0411-8756 2176

### 华南/西南/华中地区

- 深圳分公司 ☎ +86-0755-2962 2620  
 ●广州分公司 ☎ +86-020-3708 4205  
 ●武汉分公司 ☎ +86-027-8425 3500  
 ●重庆分公司 ☎ +86-023-6036 0877  
 ●襄阳生产工厂 ☎ +86-0710-3311 813

### 港澳台地区

- 香港公司 ☎ +852-2687 6745  
 ●中日龙股份有限公司(台北市)  
 ..... ☎ +886-2-2836 0039  
 ●台南营业所 ☎ +886-6-273 8985  
 ●台中营业所 ☎ +886-4-2463 1361